


# 4RUNNER

## OUTLINE OF NEW FEATURES

The following changes are made for the 2008 model year.

### 1. Exterior

The design of the front bumper grille has been changed.

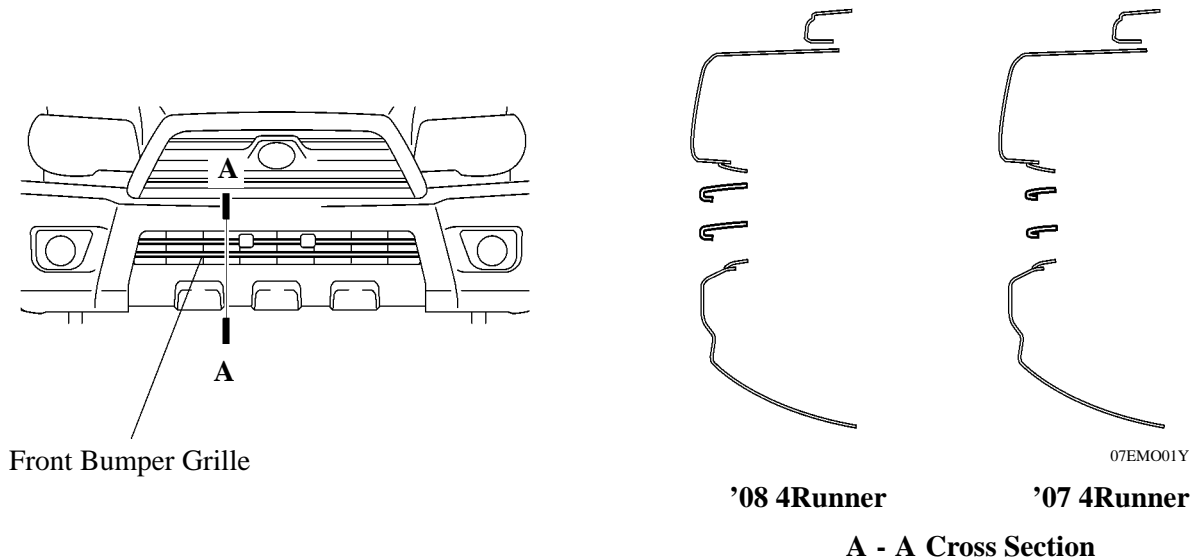

### 2. Brake Control System

- The VSC OFF switch is used on all models. For details, see page 5.
- An Auto LSD function is added to the brake control system for the 1GR-FE engine 4WD models.

### 3. Tire Pressure Warning System

- In the tire pressure warning system, the following items have been changed.

Changed Item	'08 4Runner	'07 4Runner
Time required for the tire pressure warning ECU to determine a malfunction in the tire pressure warning valve and transmitter	20 minutes	51 minutes
Detection of vehicle speed (Judgment of vehicle running)	Vehicle speed signal (combination meter) and engine speed signal (ECM)	Vehicle speed signal (combination meter)
The illumination pattern of the tire pressure warning light when the system fails	Turns ON after blinking for 1 minute	Blinks
The blinking of the tire pressure warning light between the registration of the ID code of the tire pressure warning valve and transmitter and the normal operation of the system	Turns ON after blinking for 1 minute	—

- The following DTCs (Diagnostic Trouble Codes) are added.

DTC	Detection Item
C2126/ 26	Transmitter ID not Received in Main Mode
C2173/ 73	Vehicle Speed or Engine Speed Signal Malfunction
C2194/ 94	Engine Speed Signal Error (Test Mode DTC)

#### **4. Seat Belt Warning System**

The specifications of the seat belt warning system have been changed. For details, see page 9.